

Date: Tuesday, 11/14/2006 10:05:04 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 350 SKIDTUBE ASSEMBLY LH
 Job Number : 29428
 Estimate Number : 10262
 P.O. Number : N/A Part Number : D350636011
 This Issue : 11/14/2006 S.O. No. : N/A Drawing Number : D2750
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : D
 Previous Run : 29034 Material : N/A
 Due Date : 11/30/2006 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : *KS 06.11.14*
 Comment : Est Rev: I 02-09-25 Rearranged procedure steps KJ
 Est Rev: J 06-03-23 As per Rev D JLM
 Est Rev: J 06-07-13 As per dsi9343 EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-011 CHG 002

KS 06.11.14 ①

2.0

D26003BENT

Extrusion Bent



Comment: Qty: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2600-3-Bent

Extrusion (Bent)

626787
Pm 06-12-12 ①

3.0

D2744

Fwd Cap



Comment: Qty: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap:

Batch:

B27559
BE 6-12-12

4.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld D2744 Cap as per Dwg D2750 and QSI 004 Fill grooves in bend left from bending as per QSI 004

A/R

Aluminum Rod

m 101446 BE 6-12-12

2-Grind welds flush as per Dwg D2750

BE 6-12-13

3-Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

KS 06-12-12

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:04 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details). Drill using drill Jig DT8150 & DT8863 drilling holes labelled "A" only.

5- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.

6-Drill pilot holes for Detail B using DT8330

7-Open up holes for Detail B, "hole size W" and blade fitting location holes to 0.500" (total of 9 holes per side) as per dwg D2750

8-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.250" ***Make sure that wearplate holes are on bottom of tube*****

9-Open up holes of Detail A to 0.250" (total of 2 holes per side)

10- Countersink all fwd wearshoe holes (total of 19 holes per side) DO NOT C'SINK THE LAST AFT HOLES (total of 2 per side for blade fitting) as per dwg D2750.

11-Countersink Detail A as per dwg D2750.

12- Scribe batch# inside per dwg D2750

BE 06-12-13

BE 06-12-12

IT
06-12-12

5.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

11-06-12-14 (1)

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP
06-12-14 (1)

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

BE 06-12-18

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 06-12-18

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/01/10
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
06-12-12	5.10	Employee drilled C sink 1 hole At the aft 4 holes for wear plates. Human error	J 05/01/12	Fill hole with weld as per QSI042 And grind flush. Redrill hole with DT 830 as per chg.	Weld BE 6-12-12 drill	J 07-01-09	J 05/01/12	J 06-12-12

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:04 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description:

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Web

Batch:

29316 JF 06-12-18 (2)

10.0

D34901

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

B28874 BF 06-12-19

11.0

D34903

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

B29016 BF 06-12-19

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Crossbolt Spacer

Batch:

B27741 BF 06-12-19

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail V & Detail C to 0.625" (total of 8 holes per side)
as per dwg D2750.

Pmc 06-12-18 (1)

2-Open up holes of Detail D to 0.750" (total of 4 holes per side)
as per dwg D2750.

Pmc 06-12-18 (1)

3-Chamfer holes of Detail V, Detail C, Detail D and hole size "W" per dwg D2750 (welding instructions on sheet 4)

Pmc 06-12-18 (1)

4-Deburr and blow out all chips from inside of tube

Pmc 06-12-18 (1)

6-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

exp. date:

m 102 672 JF 06-12-18 (1)
07-02-01

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

7- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004

(welding instructions on sheet 4)

A/R

Aluminum Rod

batch:

8-Grind welds flush as per Dwg D2750

9-Spot face ground handling holes section J-J (total of 4 places per side) as per dwg D2750

10-Deburr holes

14.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

18.0

NAS1330S3KB166

INSERT



Comment: Qty.: 42.0000 Each(s)/Unit Total: 42.0000 Each(s)

INSERT

Batch:

19.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install inserts as per Dwg D2750

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

FC 07/01/05 ①

21.0

D26483

Wearpad



Comment: Qty.: 5.0000 Each(s)/Unit Total : 5.0000 Each(s)

Wearpad

Batch: B29038

22.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B27739

23.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B26206

24.0

D2746

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B22257

25.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: M28974

26.0

D3488041

BLADE FITTING ASSEMBLY, LH



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, LH

Batch: B26838

M.R./a.m 07/01/05 ①

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

D3492041

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B 29017

28.0

D3492043

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B 27974

29.0

AN3C5A

Bolt



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Bolt

Batch: M15205 M102535

30.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M19522

31.0

AN3C7A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M102254

32.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M102697

33.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M102180

M.R. / a.m. *07/01/05 (1)*

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC, Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

AN960C10L

washer



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

washer

Batch: M102079

35.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M100186

36.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: M100537

37.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: M100186

38.0

NAS1515H3L

WASHER



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

WASHER

Batch: M102404

39.0

NAS1515H8L

WASHER



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

WASHER

Batch: M102535

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3"

batch: M101915

a.m

07/01/08

(1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description:

3-Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: M102672

EXP DATE: 02/07

4-Coat all exposed fasteners with "LPS Procyon"

batch: M17/68

q-m 02/01/08

41.0

QC5

INSPECT WORK TO CURRENT STEP



F 07-01-090



Comment: INSPECT WORK TO CURRENT STEP

42.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

43.0

D2741

Blade



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: B2852 ✓

44.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M100186 ✓

45.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Nut

Batch: M100186 ✓

46.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M102473 ✓

JB 01/01/10

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Tuesday, 11/14/2006 10:05:06 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 29428

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

47.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: 1102515 ✓

48.0

D34931

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: 627835 ✓

49.0

D35321

spacer



Comment: Qty.: 2.0000 (s)/Unit Total : 2.0000 (s)

batch: 627894 ✓

50.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

51.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-011

52.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 07.0.10

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DARTRELEASED
06.02.07. #


DESIGN <i>PH</i>	DRAWN BY <i>PH</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2750	REV. D SHEET 1 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3/D2750-4 INCORPORATE D2738 AND D2740	
D	06.01.05	ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133/9157	

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
5	5	5	5	D2648-3	WEARPAD
1	1	1	1	D2656-13	WEARSHOE
1	1	1	1	D2656-35	WEARSHOE
1	1	1	1	D2746	WEARSHOE
1	1	1	1	D2739	WEB
1	1	1	1	D2741	BLADE
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
38	38	38	38	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN3C7A	BOLT
4	4	4	4	AN6C44A	BOLT
2	2	2	2	AN8C21A	BOLT
1	1	1	1	AN8C35A	BOLT
46	46	46	46	AN960C10L	WASHER
4	4	4	4	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
3	3	3	3	MS21083C8	NUT
42	42	42	42	NAS1330S3KB166	INSERT
46	46	46	46	NAS1515H3L	WASHER
12	12	12	12	NAS1515H8L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29428

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

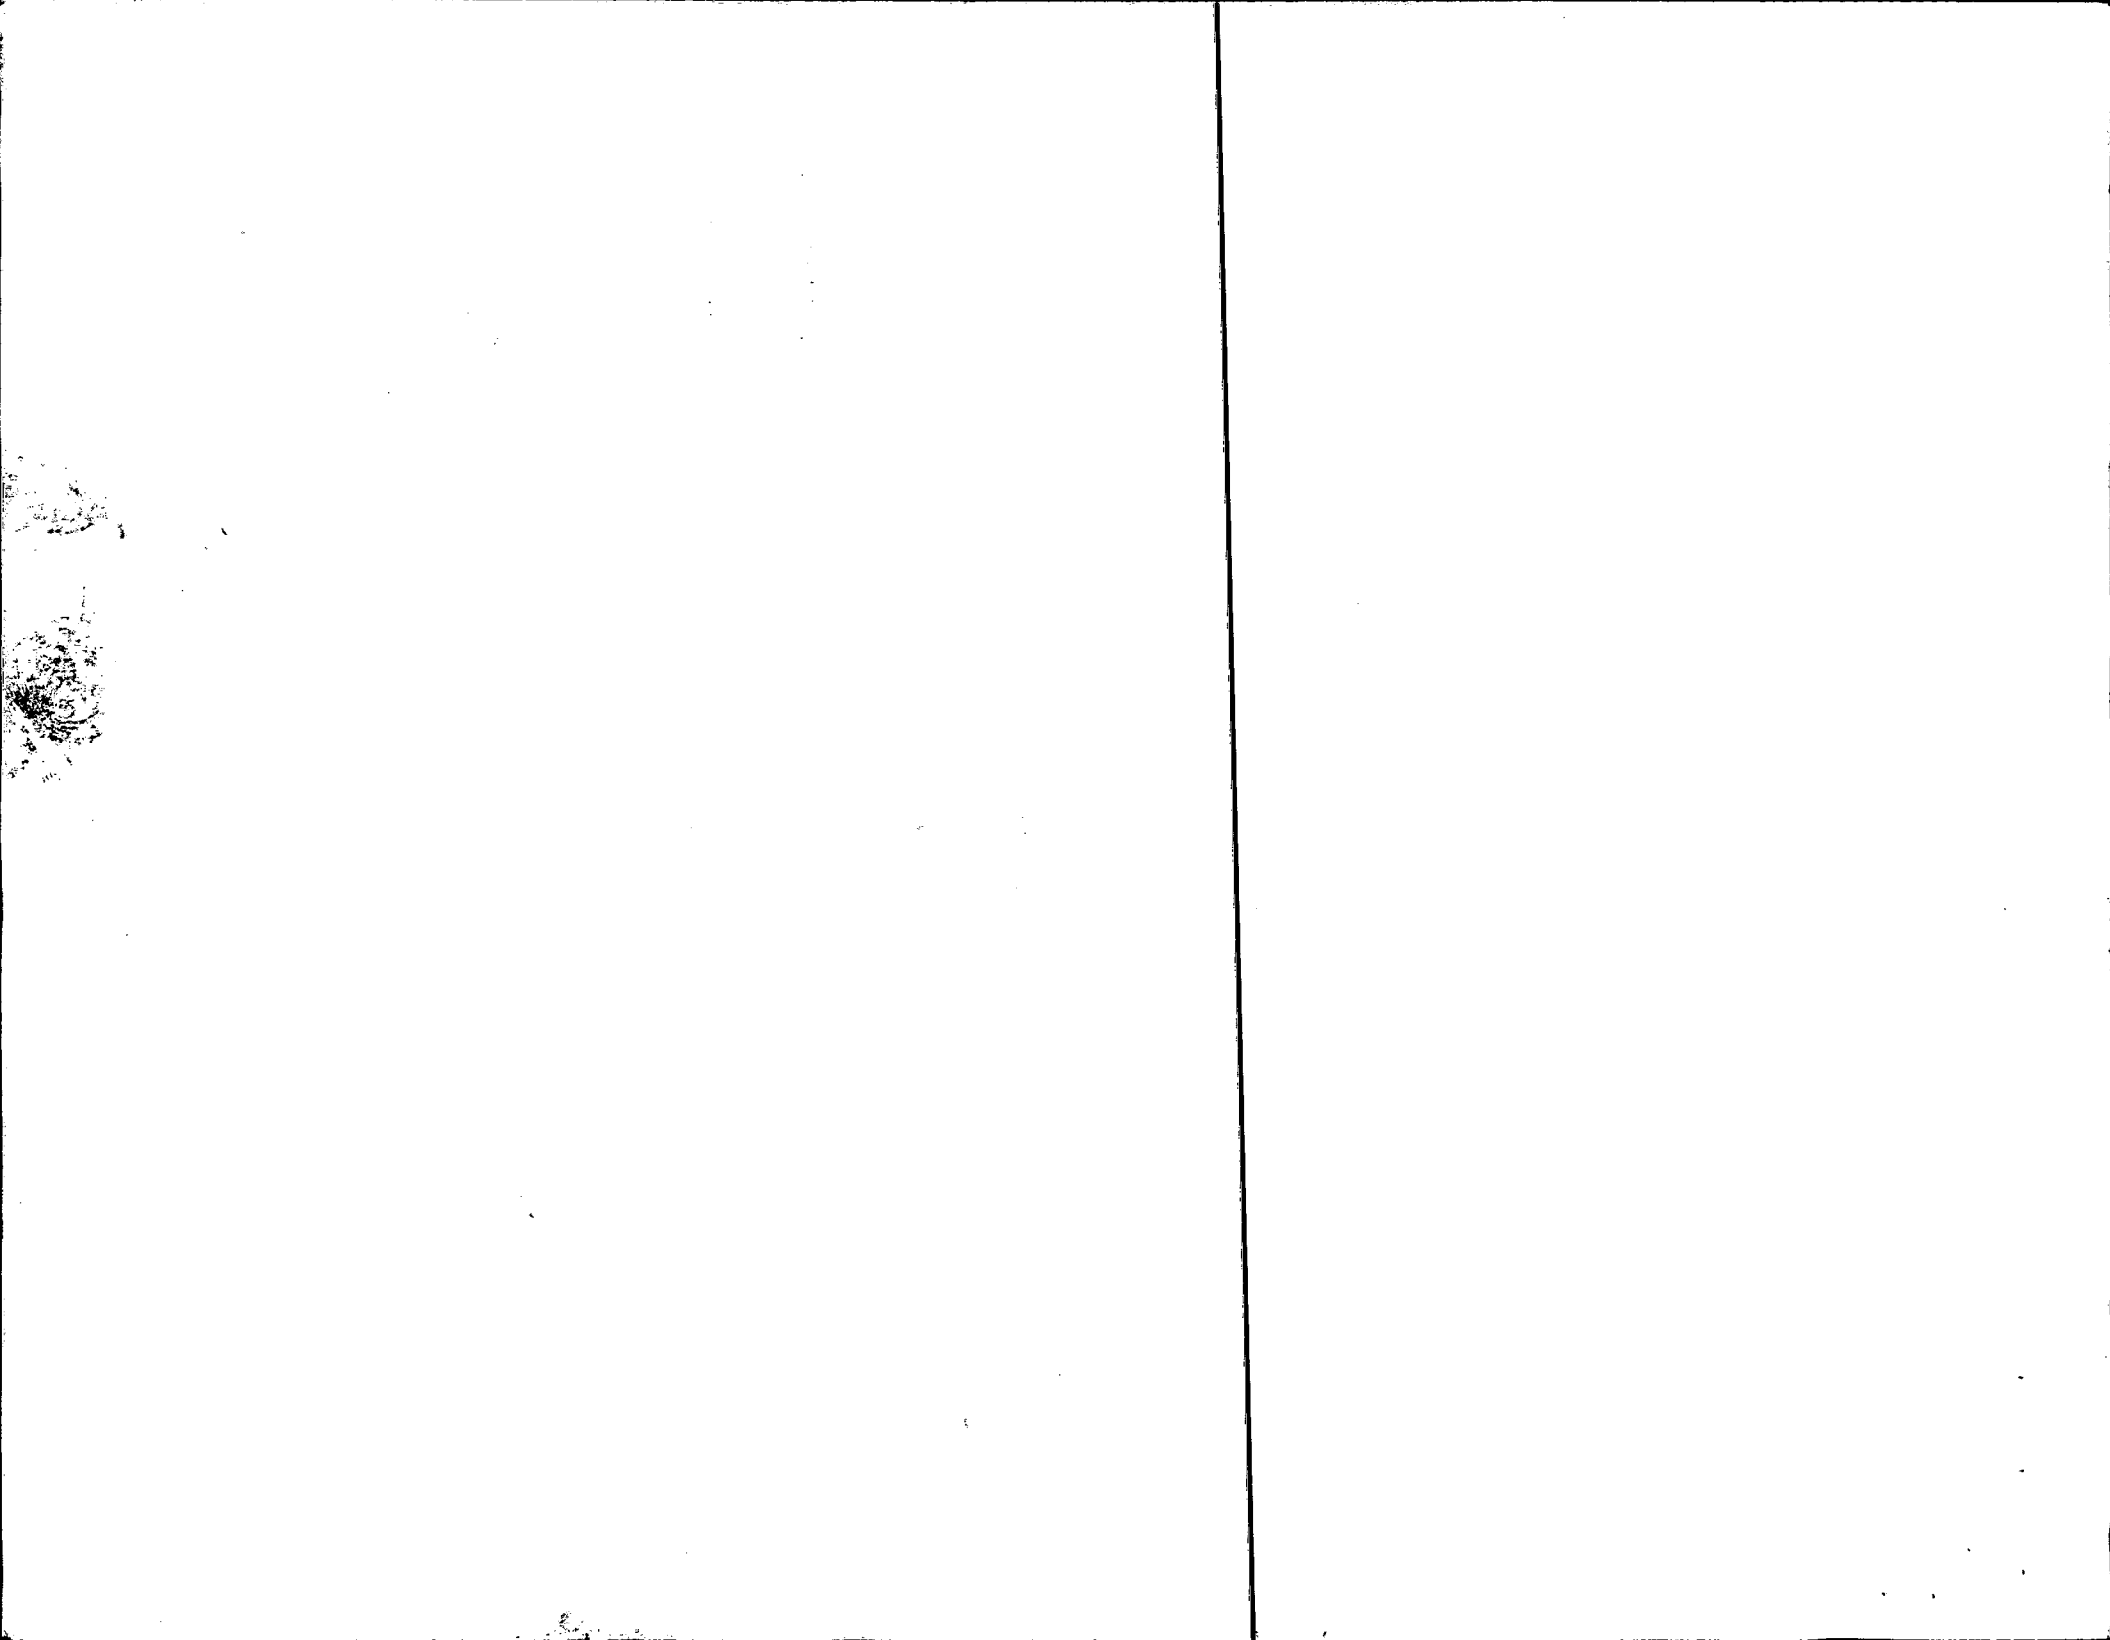

DART

DESIGN PH	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED PH	APPROVED PH	DRAWING NO. D2750	REV. 0 SHEET 2 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS


RELEASED
06.02.07GENERAL NOTES:

1. ALL DIMENSIONS ARE IN INCHES
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.150 ± 0.010 IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.15 ± 0.030 IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS E-E, F-F, AND R-R.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 ksi
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL NAS1330S3KB166 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4 AND 5. DRILL 'E' SIZE HOLES ($\emptyset 0.250$ - $\emptyset 0.257$) FOR WEARSHOE INSERTS. C'SINK $\emptyset 0.391 \times 100^\circ$ AND INSTALL INSERTS
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3-5A/AN3-7A WEARSHOE SCREWS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
12. APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES



SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBMIT AMENDMENT
WITHOUT NOTICE
WORK ORDER
79428

Copyright © 1998 by DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

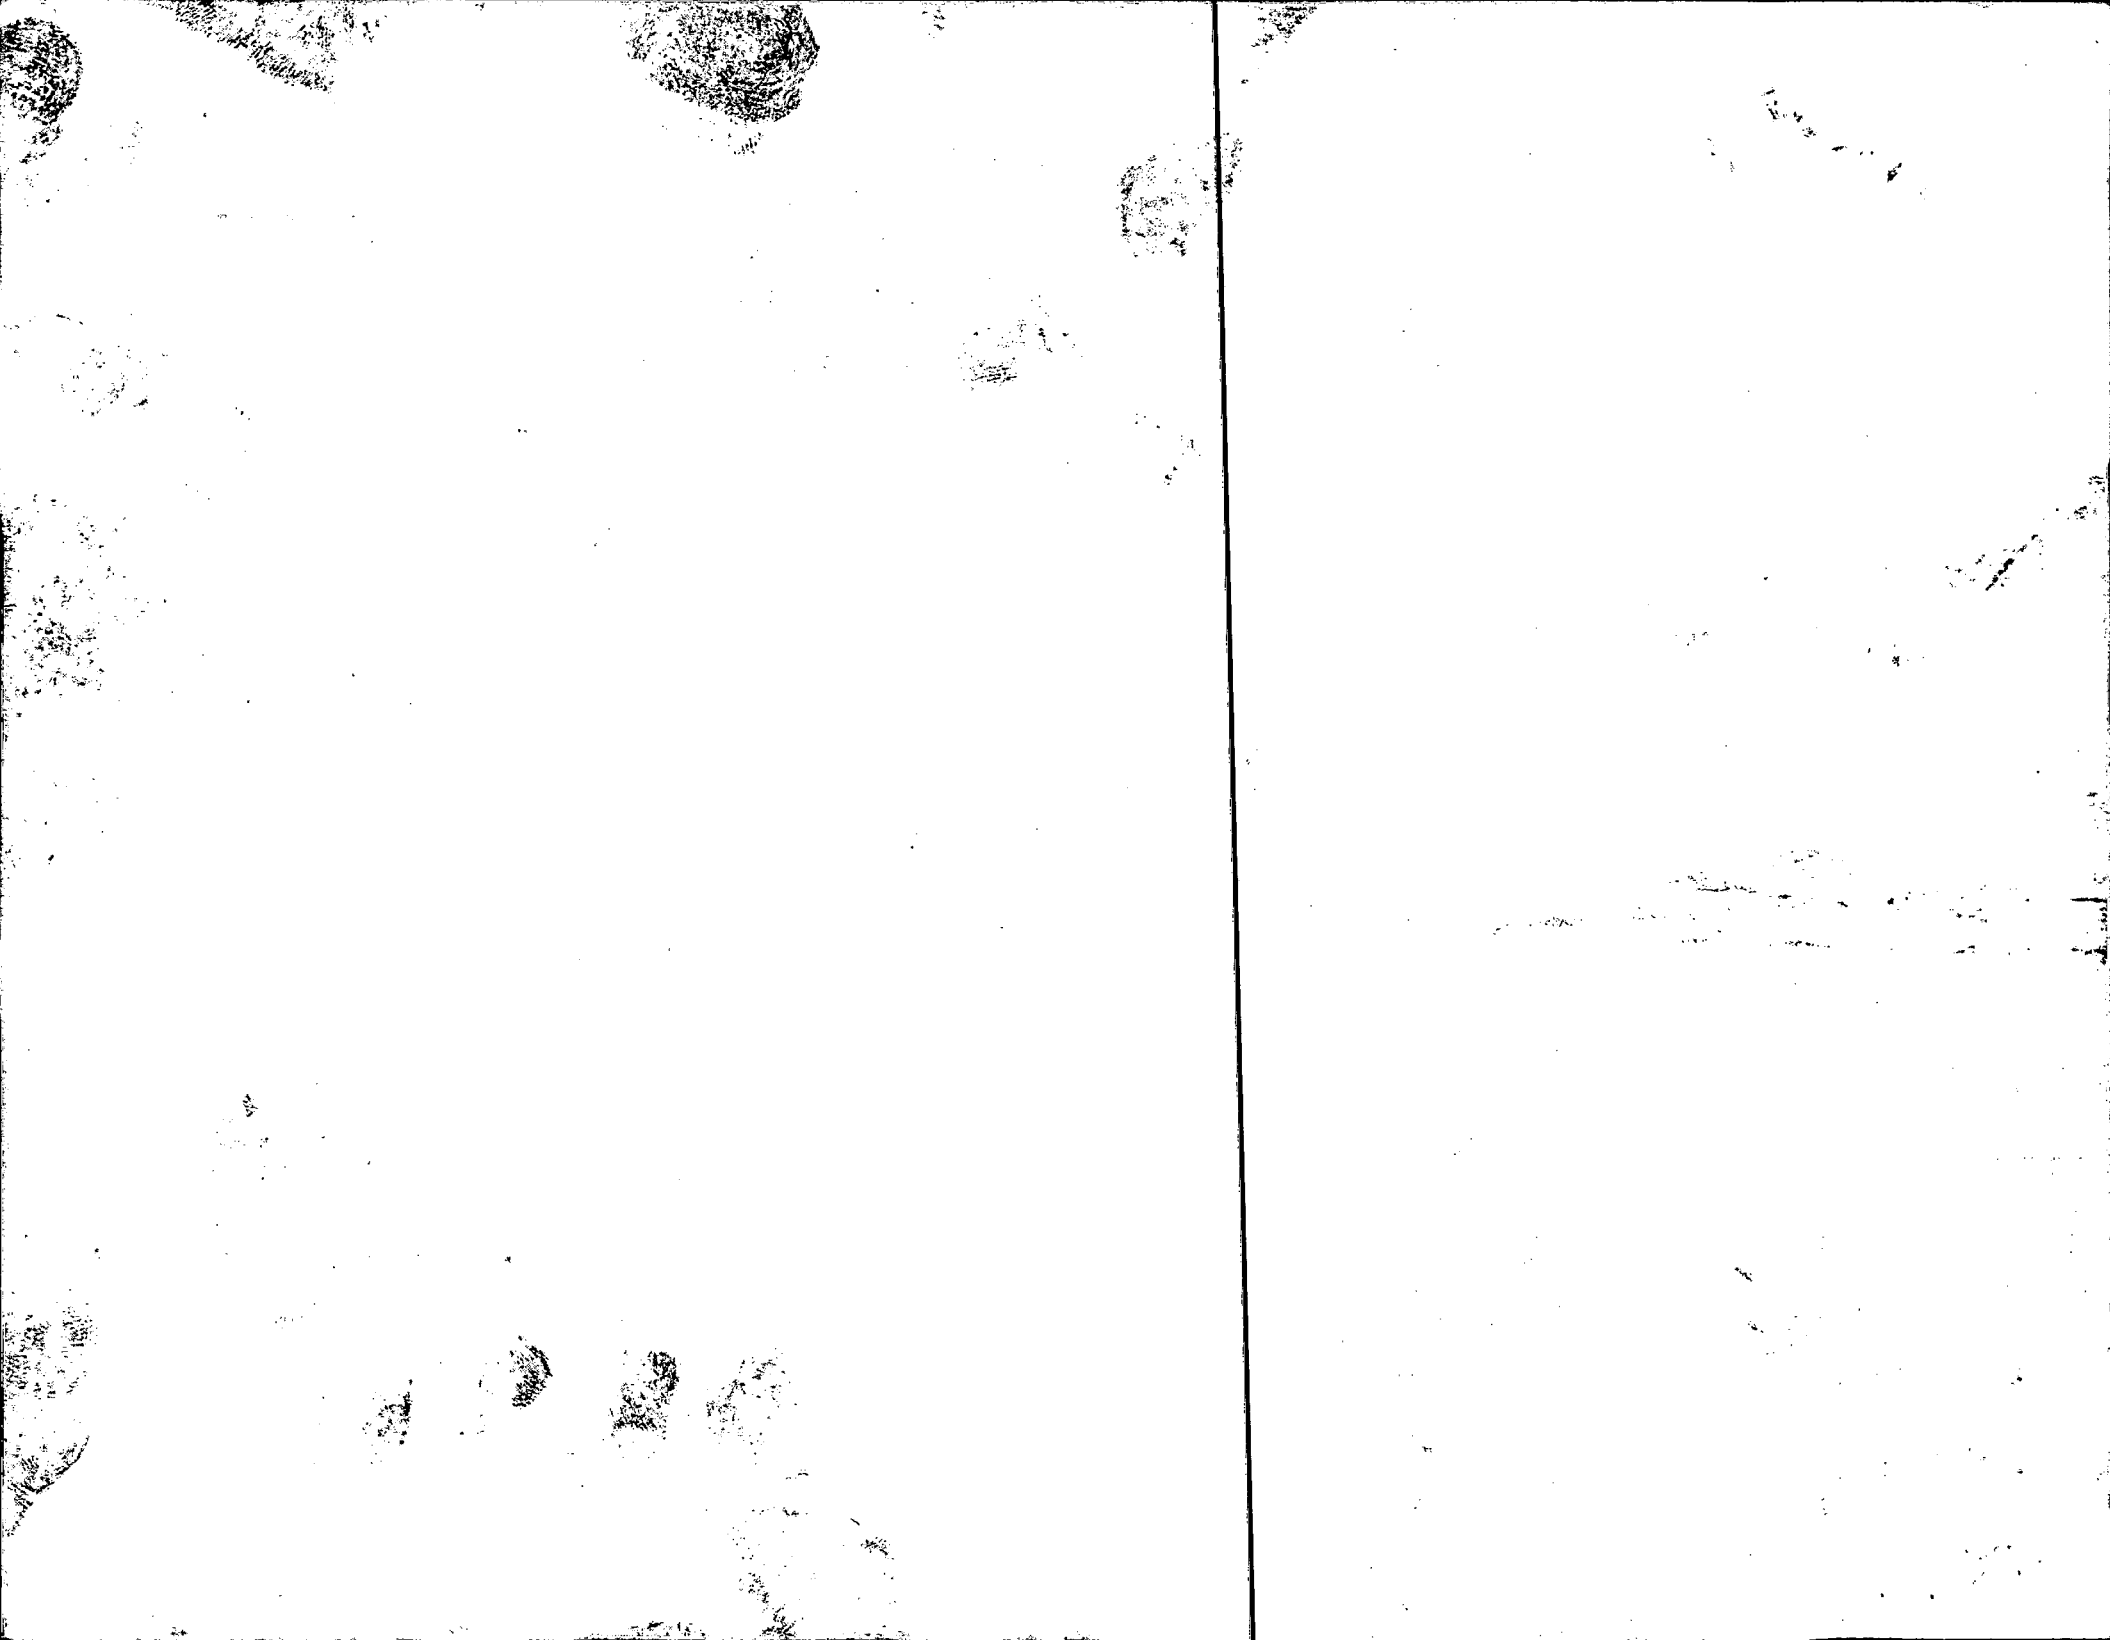

RELEASED
02-07-78

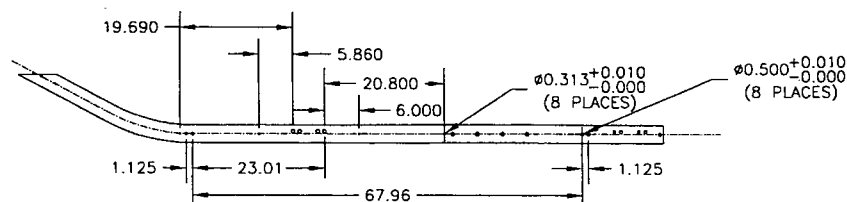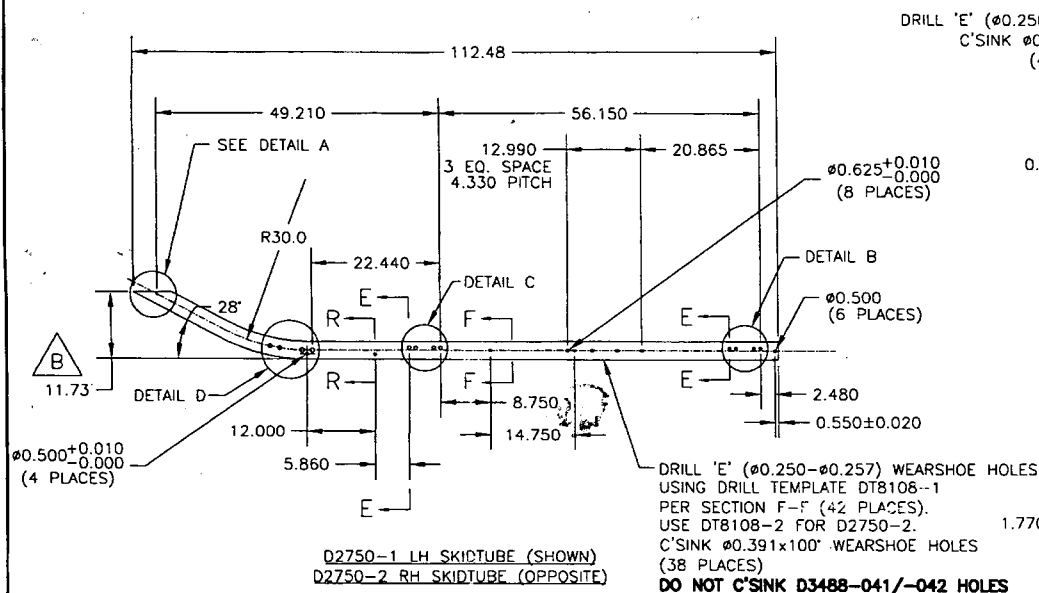



D2750-3/-4 AND D2750-1/-2 HAVE THE SAME SADDLE AND GROUND HANDLING HOLES

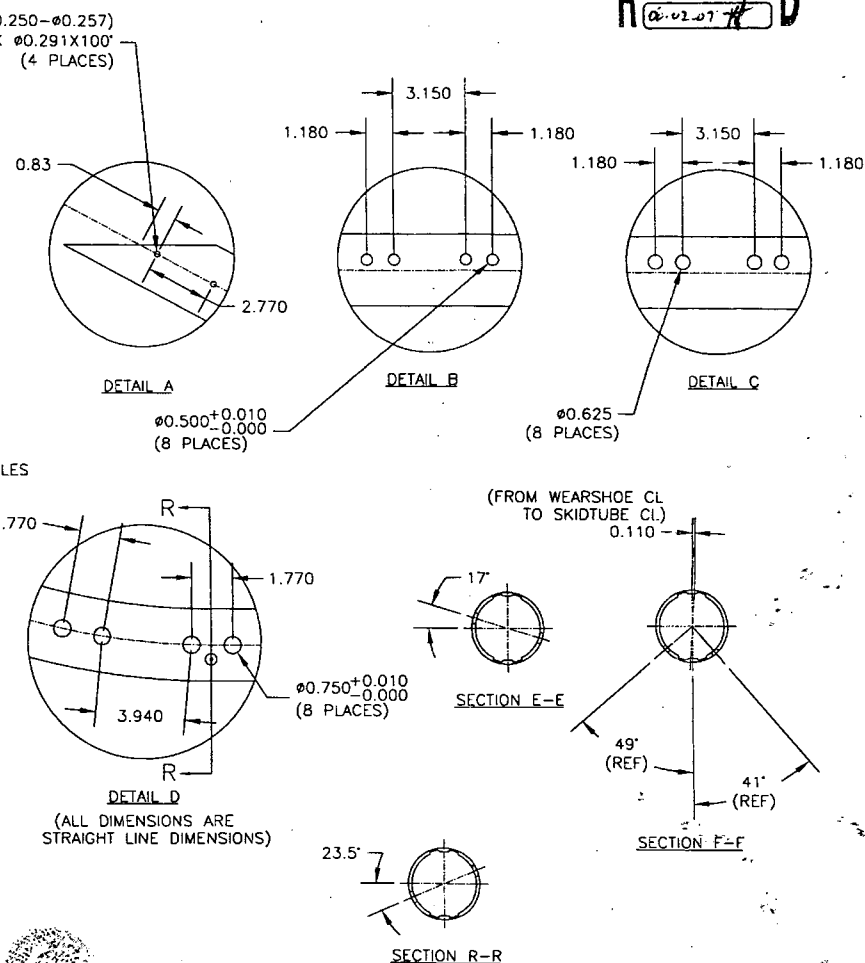



WORK ORDER NO. 24428
SHOP COPY
RETURN TO
ENGINEERS
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.		DESIGN PH	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. D
CHECKED #	APPROVED #	DRAWING NO. D2750	SHEET 3 OF 5		
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY		SCALE 1:20	

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

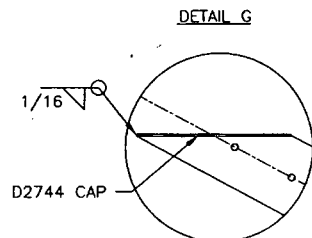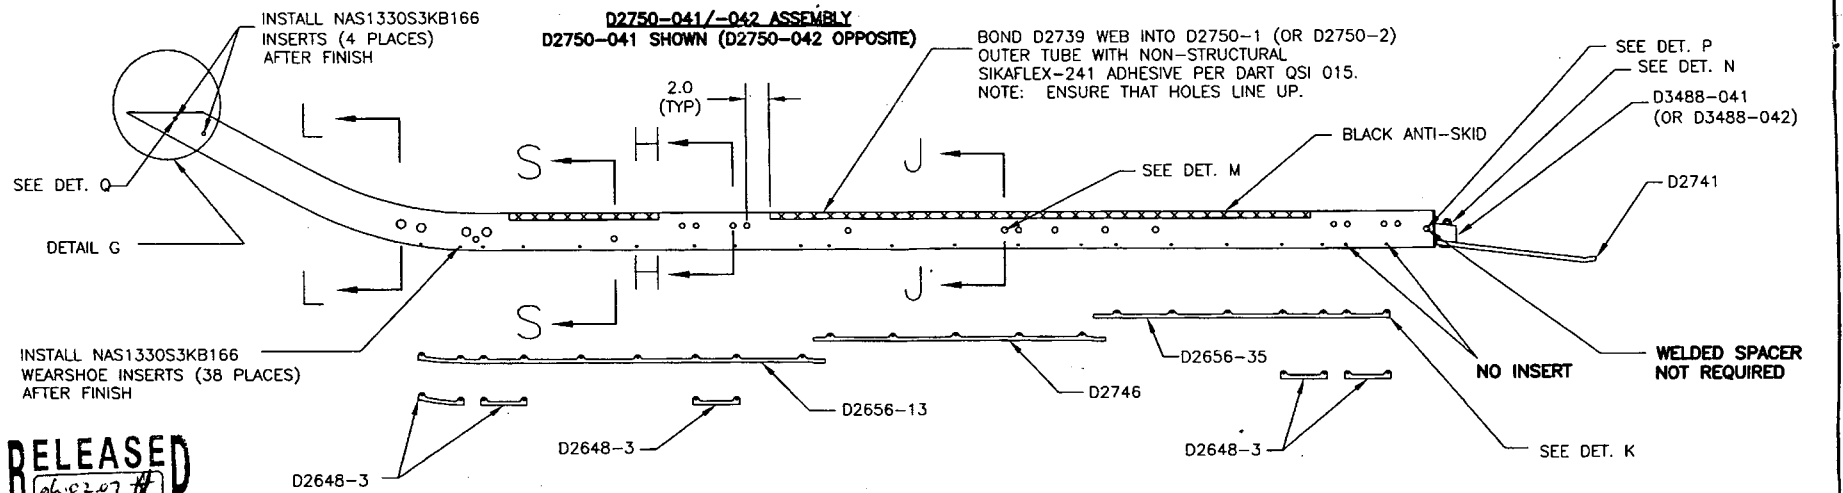

SECTION H-H D2743 SPACER (REF)

  

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO Ø0.484
6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

SECTION L-L

D3490-3 SPACER (TYP)

Ø0.750 HOLES ONLY

D3492-043 PLUG ASSEMBLY

SECTION S-S

 
D3490-1 SPACER (TYP)

Ø0.500 HOLES ONLY

D3492-041 PLUG ASSEMBLY


WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES OR INSERT D3490-3 SPACER (4 PLACES) INTO Ø0.750 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER OR INSERT D3492-043 PLUG ASSEMBLY (8 PLACES) INTO D3490-3 SPACER ON BOTH ENDS




AN3C5A BOLT (1)
 AN960JD10L WASHER (1)
 NAS1515H3L WASHER (1)
 (38 PLACES)

 DETAIL M




AN6-44A BOLT (1)
 D2745 BUSHING (2)
 NAS1515H8L WASHER (2)
 MS21043-6 NUT (1)
 (4 PLACES)
NOTE: INSTALL WASHER BETWEEN SKIDTUBE AND BUSHING

DETAIL N

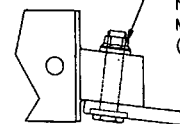


AN8C21A BOLT (1)
 AN960JD816L WASHER (1)
 NAS1515H8L WASHER (1)
 MS21083C8 NUT (1)
 (2 PLACES)

DETAIL P

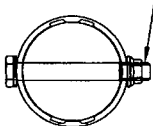

AN8C35A BOLT (1)
 AN960C816L WASHER (2)
 NAS1515H8L WASHER (2)
 MS21083C8 NUT (1)

DETAIL Q

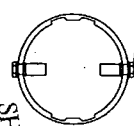


AN3C6A BOLT (1)
 AN960C10L WASHER (1)
 NAS1515H3L WASHER (1)
 (4 PLACES)



COPYRIGHT © 1996 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN	PH	DRAWN BY	PH	DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED	#	APPROVED	#	DRAWING NO. D2750
DATE	06.01.05	TITLE	350 SKIDTUBE ASSEMBLY	REV. 0 SHEET 4 OF 5 SCALE 1:20

NO. 29428
 WORK ORDER
 WITHOUT NOTICE
 SUBJECT TO AMENDMENT
 UNCONTROLLED COPY
 ENGINEERING
 RETURN TO
 SHOP COPY

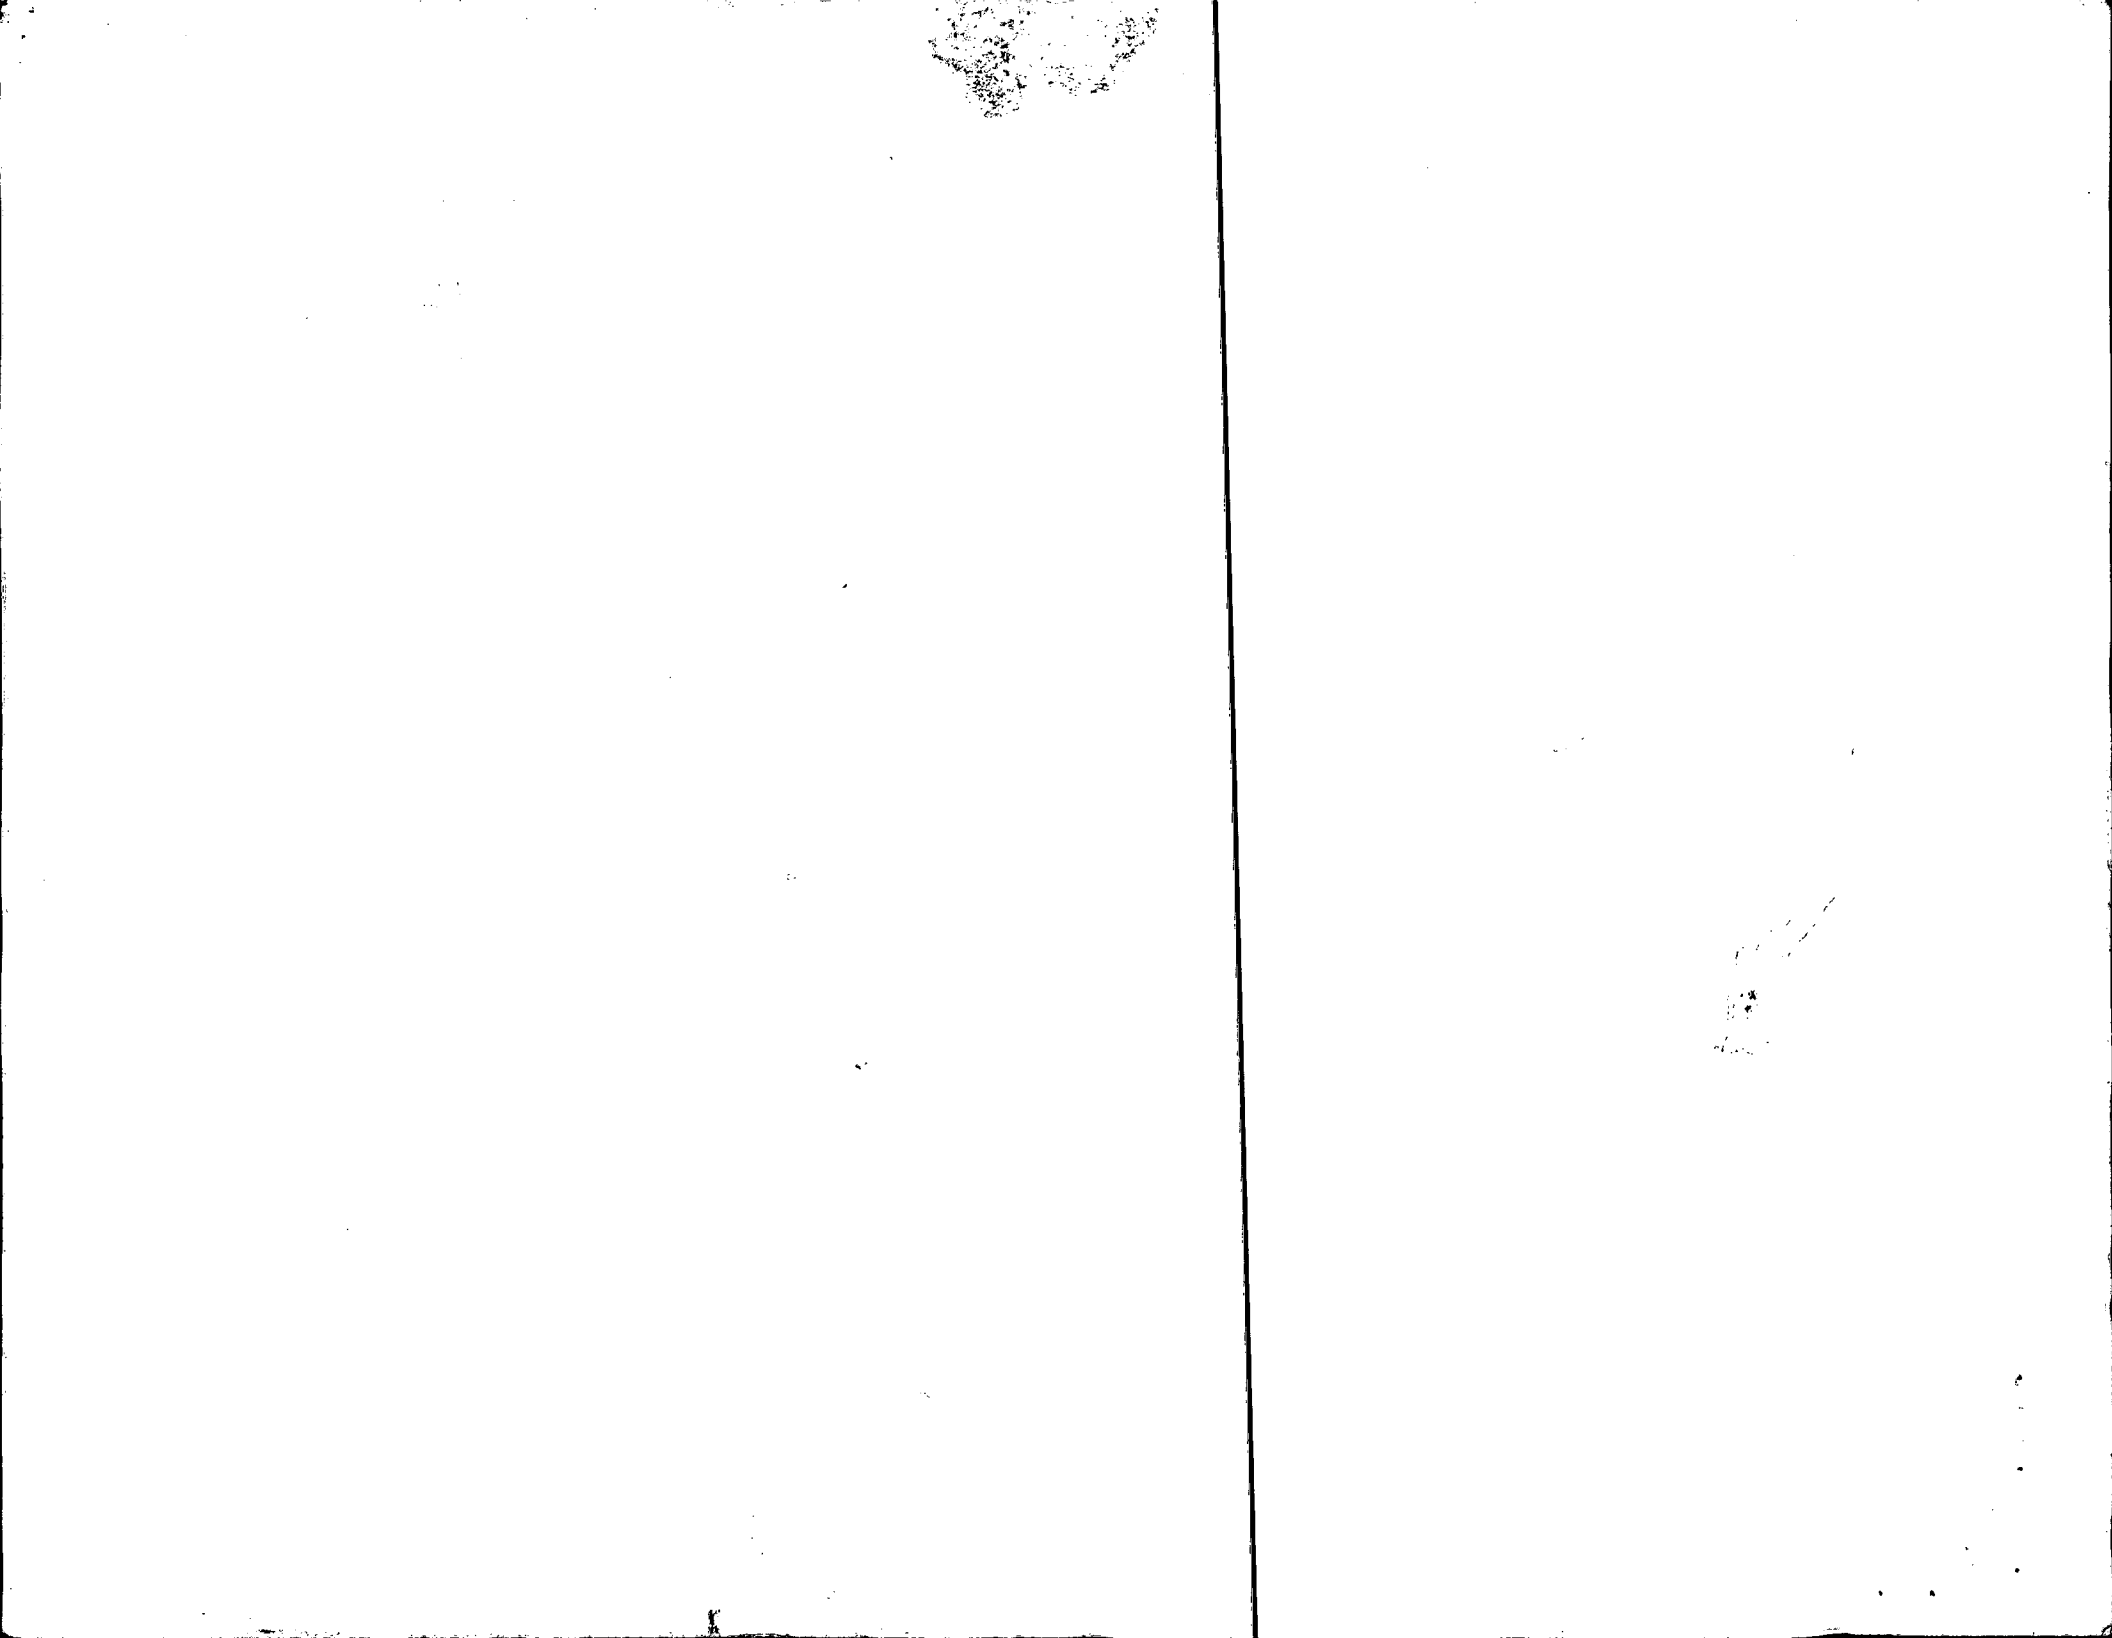

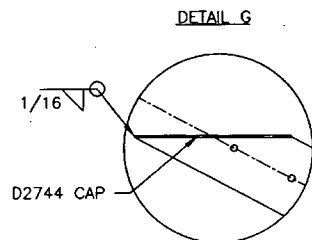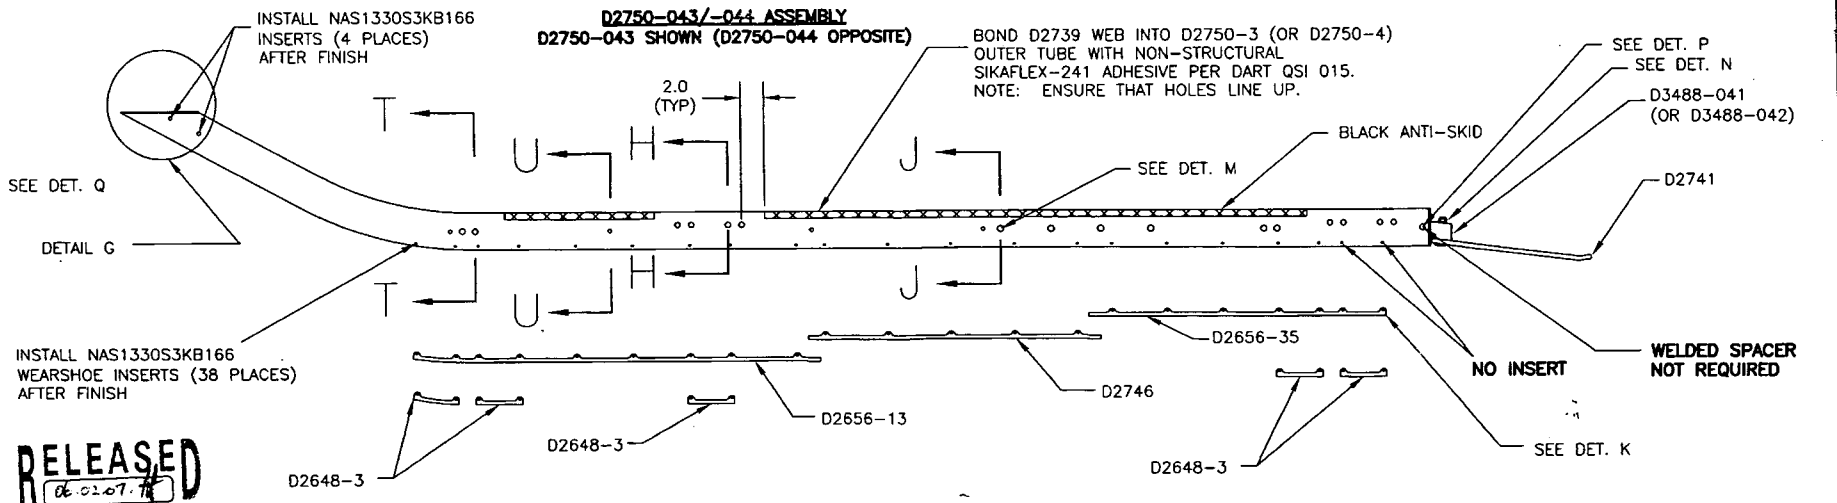


SECTION H-H D2743 SPACER (REF)

  

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO Ø0.484
6. SPOT FACE Ø0.750 (SECTION J-J ONLY)


DETAIL M

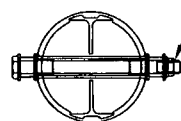

- AN6C44A BOLT (1)
 D2745 BUSHING (2)
 NAS1515H8L WASHER (2)
 MS21043-6 NUT (1)
 (4 PLACES)

NOTE: INSTALL WASHER BETWEEN SKIDTUBE AND BUSHING

DETAIL Q

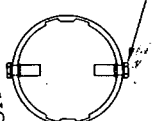

- AN3C6A BOLT (1)
 AN960C10L WASHER (1)
 NAS1515H3L WASHER (1)
 (4 PLACES)


SECTION T-T

D3490-1 SPACER

Ø0.500 HOLES ONLY

D3492-041 PLUG ASSEMBLY

DETAIL N

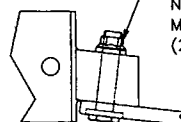

- AN8C21A BOLT (1)
 AN960JD816L WASHER (1)
 NAS1515H8L WASHER (1)
 MS21083C8 NUT (1)
 (2 PLACES)

SECTION U-U

D3490-5 SPACER

Ø0.313 HOLES ONLY

D3492-045 PLUG ASSEMBLY

WELDING INSTRUCTIONS


1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-5 SPACER (4 PLACES) INTO Ø0.313 HOLES OR INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-045 PLUG ASSEMBLY (8 PLACES) INTO D3490-5 SPACER OR INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER ON BOTH ENDS

COPYRIGHT © 1995 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	DH	DRAWN BY	DH	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	#	APPROVED	#	DRAWING NO. D2750
DATE	06.01.05	TITLE	350 SKIDTUBE ASSEMBLY	REV. D SHEET 5 OF 5 SCALE 1:20

NO. 294228
 WORK ORDER
 SUBJECT TO ADJUDICATE
 WITHOUT NOTICE
 UNCONTROLLED COPY
 RETURN TO
 SHOP COPY
 ENGINEERING

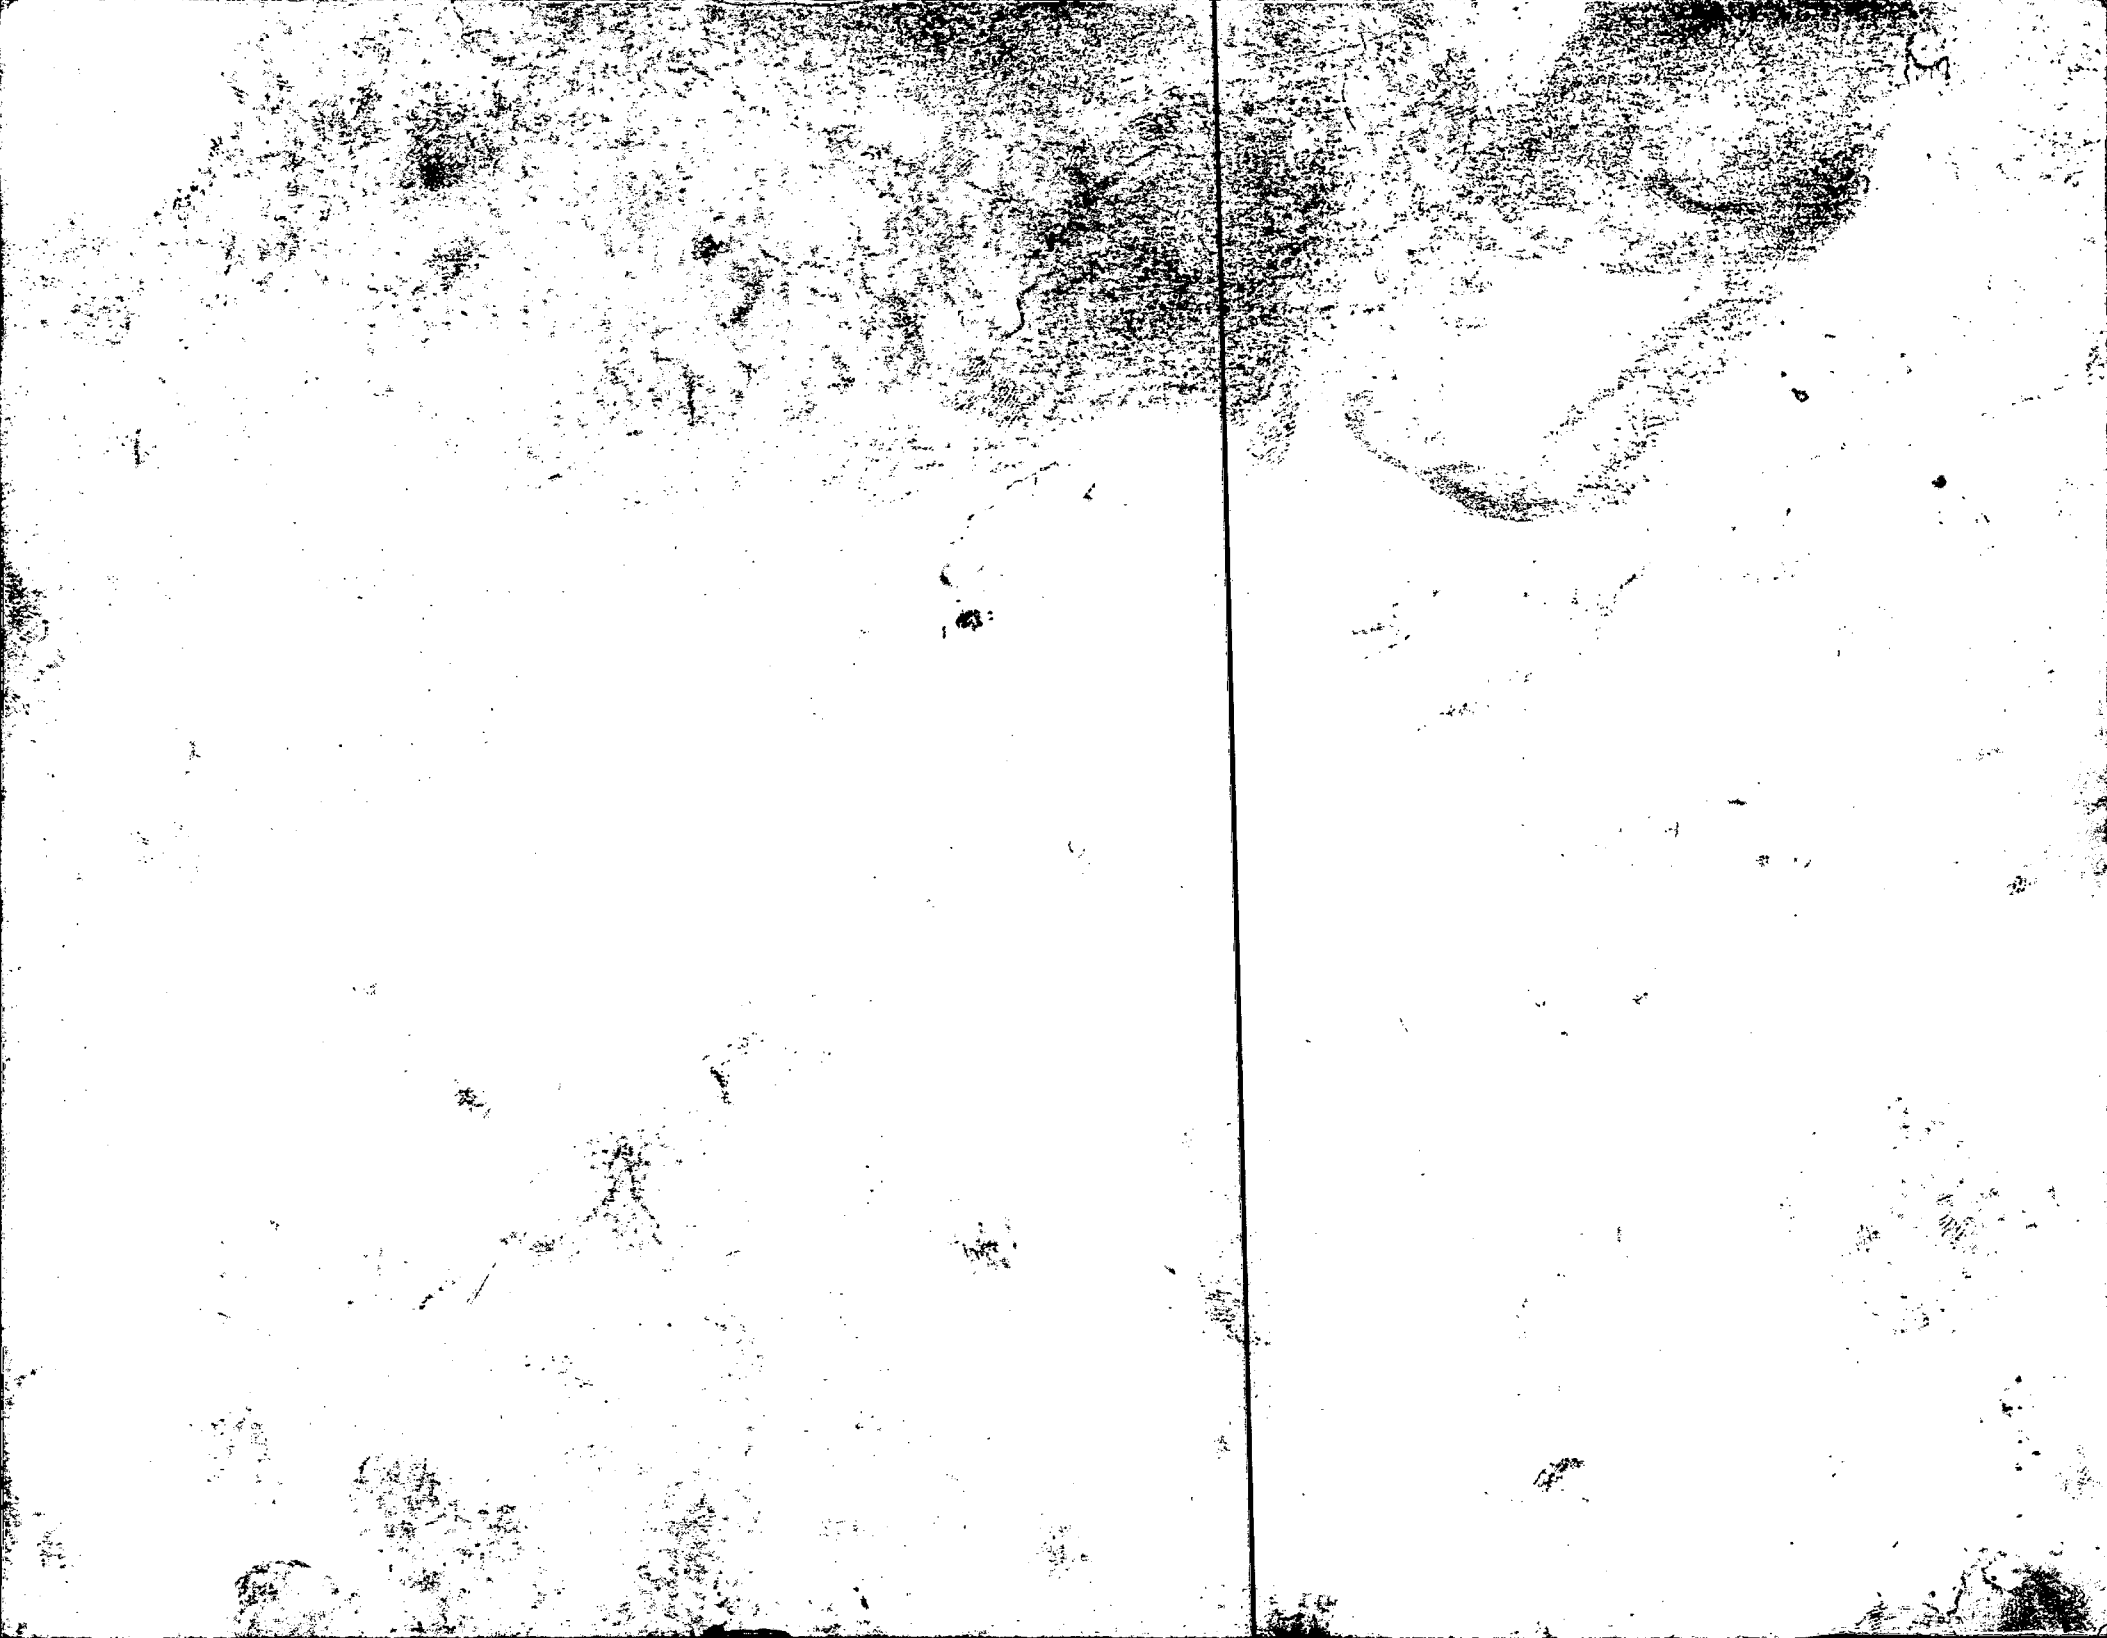

NO. 82

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A350 636 011/B29428

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input checked="" type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input checked="" type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input checked="" type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input checked="" type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into _____ Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 06/12/18 Qualifier David A. Avel

